



HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS

Parent to HomeReportScotland.scot




**HOME**  
report

SINGLE SURVEY  
ENERGY REPORT  
PROPERTY QUESTIONNAIRE  
VALUATION REPORT



# HOME REPORT INDEX

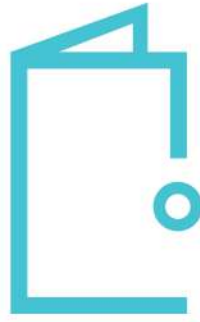

HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS  
Parent to HomeReportScotland.scot

1. Single Survey
2. Energy Report
3. Property Questionnaire



# Single Survey

survey report on:

|                         |   |
|-------------------------|---|
| <b>Property address</b> | 10 St Modans Place,<br>Fraserburgh,<br>AB43 9NT |
|-------------------------|---|

|                 |             |
|-----------------|-------------|
| <b>Customer</b> | Mr I Graham |
|-----------------|-------------|

|                         |  |
|-------------------------|--|
| <b>Customer address</b> |  |
|-------------------------|--|

|                    |                             |
|--------------------|-----------------------------|
| <b>Prepared by</b> | Harvey Donaldson And Gibson |
|--------------------|-----------------------------|

|                           |                |
|---------------------------|----------------|
| <b>Date of inspection</b> | 15th July 2022 |
|---------------------------|----------------|



HARVEY  
DONALDSON  
& GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

# Terms and Conditions

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

# Terms and Conditions

contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

# Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES



# Terms and Conditions

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

|  |   |
|--|---|
| <b>Description</b>                               | A purpose built first floor flat in a mid terraced two storey block with barber shop and convenience store on ground floor.   |
| <b>Accommodation</b>                             | The accommodation comprises:<br>First floor-Entrance hallway, living room with kitchen off, two bedrooms, bathroom with w.c.  |
| <b>Gross internal floor area (m<sup>2</sup>)</b> | 61  |
| <b>Neighbourhood and location</b>                | The subjects form part of an established Local Authority area lying to the southwest of Fraserburgh town centre. Surrounding properties are of a mixed residential and commercial nature. A wide range of facilities and amenities can be found within Fraserburgh. |
| <b>Age</b>                                       | 67 years.   |
| <b>Weather</b>                                   | Dull with light rain followed by bright spells.   |
| <b>Chimney stacks</b>                            | <b>Visually inspected with the aid of binoculars where appropriate.</b><br>The chimney is of rendered masonry construction. The chimney pots are clay.  |
| <b>Roofing including roof space</b>              | The roof is pitched and covered with slates with a tiled ridge.<br>Access to the roof space is via a hatch on the hall ceiling.<br>The roof is timber framed with timber sarking boards.  |
| <b>Rainwater fittings</b>                        | <b>Visually inspected with the aid of binoculars where appropriate.</b><br>Rainwater discharge is via cast iron gutters and downpipes.  |

# Single Survey

|  |   |
|--|---|
| <b>Main walls</b>                          | <p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The walls are of solid stone construction, pointed externally.</p>   |
| <b>Windows, external doors and joinery</b> | <p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows are of a double glazed uPVC type. The entrance door is timber.</p> |
| <b>External decorations</b>                | <p><b>Visually inspected.</b></p> <p>Self coloured uPVC materials. External surfaces are painted, where applicable.</p>   |
| <b>Conservatories / porches</b>            | <p>None.</p>  |
| <b>Communal areas</b>                      | <p><b>Circulation areas visually inspected.</b></p> <p>There is shared entrance hall with staircase giving access to the upper floor.</p>   |
| <b>Garages and permanent outbuildings</b>  | <p>None.</p>  |
| <b>Outside areas and boundaries</b>        | <p><b>Visually inspected.</b></p> <p>There is an area of yard to rear, adequately bounded.</p>  |
| <b>Ceilings</b>                            | <p><b>Visually inspected from floor level.</b></p> <p>The ceilings appear plasterboard lined.</p>   |
| <b>Internal walls</b>                      | <p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal walls are partly plastered on the hard and partly lined in plasterboard.</p>   |

# Single Survey

|  |   |
|--|---|
| <b>Floors including sub floors</b>           | <p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>Flooring throughout the property is of suspended timber design, overlaid in tongue and groove boarding, all of which have fully fitted floor coverings.</p> |
| <b>Internal joinery and kitchen fittings</b> | <p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>The internal doors are timber panelled. The skirting boards and door surrounds are timber.</p> <p>The kitchen fittings consist of floor and wall mounted units.</p>  |
| <b>Chimney breasts and fireplaces</b>        | <p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>The chimney breast is plastered masonry.</p> <p>There is an open fire within a tiled and pointed stone fireplace..</p>  |
| <b>Internal decorations</b>                  | <p><b>Visually inspected.</b></p> <p>Papered and painted walls and ceilings, and painted woodwork. Some walls have sections of timber panelling.</p>  |
| <b>Cellars</b>                               | <p>None.</p>  |
| <b>Electricity</b>                           | <p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains electricity is installed. The meter and consumer unit are located in the hall.</p> <p>The system appears to be of a 13 amp type and design. The switch and socket outlets are plastic and metal. The wiring is sheathed with PVC, where visible.</p>   |

# Single Survey

|   |   |
|---|---|
| <b>Gas</b>                                | <p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Gas is supplied from the mains. The meter is located in the kitchen.</p>   |
| <b>Water, plumbing, bathroom fittings</b> | <p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Water is supplied from the mains.</p> <p>The bathroom contains a bath with electric shower overhead, wash hand basin and WC.</p>  |
| <b>Heating and hot water</b>              | <p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The property is heated by a gas fired boiler located in the roof space. Heating to the rooms is provided by water filled radiators.</p> <p>Hot water is stored in an insulated cylinder located in the roof space.</p>   |
| <b>Drainage</b>                           | <p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Mains drainage is understood to be connected.</p>  |
| <b>Fire, smoke and burglar alarms</b>     | <p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The property has a smoke detector.</p> <p>Scottish government regulations came into effect on 1st February 2022 which will require each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then carbon monoxide alarms should also be fitted. Upgrading will be required to comply with these regulations. Purchasers should satisfy themselves with regards to compliance.</p> |

|  |  |
|--|--|
| <b>Any additional limits to inspection</b> | <p>The property had fitted floor coverings.</p> <p>No access was gained to the sub floor.</p> <p>A limited inspection was possible of the roof void due to insulation material and partial flooring.</p> <p>No close inspection was possible to enclosed areas beneath and around washing appliances and sanitary fittings.</p> <p>An external inspection was carried out from ground level within the boundaries of the property and from adjoining highways.</p> <p>Areas of the property that were covered, unexposed or inaccessible have not been inspected. It cannot be confirmed that such areas are free from infestation, decay or other defects.</p> <p>The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>It should be appreciated that further defects can arise after the date of our inspection.</p> |
|--|--|

## Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

# Single Survey

## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3   | Category 2  | Category 1                               |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |



### Structural movement

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | No obvious significant structural movement noted, on the basis of a single inspection. |



### Dampness, rot and infestation

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | An electronic moisture meter was used to measure levels of dampness, at random locations, to lower wall surfaces and floors, where accessible and without moving furniture or lifting floor coverings, if present. No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection. |



### Chimney stacks

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | From a ground level inspection, no obvious significant defects were noted to chimneyheads, allowing for normal weathering. |



### Roofing including roof space

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 2  |
| <b>Notes</b>           | Loose, damaged and a missing slate were noted.<br>It should be appreciated that a property of this age and type the roof structure and covering will require regular, ongoing maintenance. |



# Single Survey



## Rainwater fittings

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | Cast iron components show signs of corrosion.<br>A missing section of gutter was noted. |



## Main walls

|                        |                                   |
|------------------------|-----------------------------------|
| <b>Repair category</b> | 1                                 |
| <b>Notes</b>           | Hairline crack noted to pointing. |



## Windows, external doors and joinery

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | No obvious significant defects were noted to windows, doors or external joinery. |



## External decorations

|                        |                                       |
|------------------------|---------------------------------------|
| <b>Repair category</b> | 1                                     |
| <b>Notes</b>           | No obvious significant defects noted. |



## Conservatories/porches

|                        |                 |
|------------------------|-----------------|
| <b>Repair category</b> | -               |
| <b>Notes</b>           | Not applicable. |



## Communal areas

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | General plaster cracking and deterioration is evident throughout, typical of a building of this age and type.<br>Weathering and deterioration was noted to the entrance door of the block. |



## Garages and permanent outbuildings

|                        |                 |
|------------------------|-----------------|
| <b>Repair category</b> | -               |
| <b>Notes</b>           | Not applicable. |



## Outside areas and boundaries

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | Outside areas and boundaries appear adequate for purpose. |



## Ceilings

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | There are areas of unevenness and minor blemishes to ceiling surfaces. |



## Internal walls

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | There is timber panelling present to sections of walls. There is the potential for further defects to be concealed behind these finishes. |



## Floors including sub-floors

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | <p>Within the limitations imposed on the inspection, no indications were noted to suggest any serious disrepair. It will however be appreciated that concealed floor timbers cannot be guaranteed to be free from defect.</p> <p>Spillage often occurs to enclosed areas around sanitary fittings and washing appliances with consequent risk of deterioration or decay. The need for repairs can be revealed when coverings and fittings are removed.</p> |



## Internal joinery and kitchen fittings

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | The internal joinery items are functional but heavily worn. |



## Chimney breasts and fireplaces

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | Flue linings require at least annual inspections by a reputable person that specialises in flues and chimneys. Inspection of the stoves/fireplaces and flues by a suitably qualified person is recommended prior to use. |



## Internal decorations

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 2  |
| <b>Notes</b>           | The internal decorations are worn and dated. |



## Cellars

|                        |                 |
|------------------------|-----------------|
| <b>Repair category</b> | -               |
| <b>Notes</b>           | Not applicable. |



## Electricity

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | <p>There are no signs of a recent test on the system.</p> <p>It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.</p> |



## Gas

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | No obvious significant defects noted. All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor. |



## Water, plumbing and bathroom fittings

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | <p>The sanitary fittings appeared generally satisfactory but dated.</p> <p>It is important to maintain a watertight finish around the various fittings and appliances to prevent water spillage causing damage to surrounding surfaces and concealed areas. It is not possible to comment on the condition of concealed areas.</p> |



## Heating and hot water

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | <p>Part of the casing is missing from the boiler. The boiler is old and its remaining economic life span may be limited. It will not be as energy efficient as a modern boiler.</p> <p>It is recommended good practice that heating systems are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.</p> |



## Drainage

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | <p>No obvious significant defects were noted to the drainage system, within the limitations of the inspection.</p> |

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

|                                       |   |
|---------------------------------------|---|
| Structural movement                   | 1 |
| Dampness, rot and infestation         | 1 |
| Chimney stacks                        | 1 |
| Roofing including roof space          | 2 |
| Rainwater fittings                    | 2 |
| Main walls                            | 1 |
| Windows, external doors and joinery   | 1 |
| External decorations                  | 1 |
| Conservatories/porches                | - |
| Communal areas                        | 1 |
| Garages and permanent outbuildings    | - |
| Outside areas and boundaries          | 1 |
| Ceilings                              | 1 |
| Internal walls                        | 1 |
| Floors including sub-floors           | 1 |
| Internal joinery and kitchen fittings | 2 |
| Chimney breasts and fireplaces        | 1 |
| Internal decorations                  | 2 |
| Cellars                               | - |
| Electricity                           | 2 |
| Gas                                   | 1 |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water                 | 2 |
| Drainage                              | 1 |

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

|   |   |
|---|---|
| <b>1. Which floor(s) is the living accommodation on?</b>                                      | First floor   |
| <b>2. Are there three steps or fewer to a main entrance door of the property?</b>             | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| <b>3. Is there a lift to the main entrance door of the property?</b>                          | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| <b>4. Are all door openings greater than 750mm?</b>   | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| <b>5. Is there a toilet on the same level as the living room and kitchen?</b>                 | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| <b>6. Is there a toilet on the same level as a bedroom?</b>                                   | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| <b>7. Are all rooms on the same level with no internal steps or stairs?</b>                   | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| <b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b> | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

The outright ownership details have not been checked by the surveyor, It is assumed that there are no unusually onerous provisions in the title documents.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialists advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The subjects form part of a block containing a flat and shop premises. It has been assumed that maintenance / repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors.

The ground floor of block is occupied by commercial use. A suitable source of mortgage finance should be obtained prior to committing to purchase.

The legal adviser should check confirm that the roads and sewers are adopted by the local authority.

It is assumed that there are no statutory, town planning, road or environmental matters which may have an adverse effect on the marketability or value of the property.

### Estimated reinstatement cost for insurance purposes

£220,000 (Two hundred and twenty thousand pounds).

Building costs are currently increasing significantly above inflation due to material and labour shortages. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.

### Valuation and market comments

We are of the opinion that the market value of the property, in its present condition, and assuming full vacant possession on 15 July 2022 can be fairly stated in the sum of:

£60,000 (Sixty thousand pounds sterling).

**Signed**

Security Print Code [462291 = 5309]O  
Electronically signed

**Report author**


Keith Alexander

# Single Survey

|                       |   |
|-----------------------|---|
| <b>Company name</b>   | Harvey Donaldson And Gibson                                   |
| <b>Address</b>        | Rubislaw Den House, 23 Rubislaw Den North, Aberdeen, AB15 4AL |
| <b>Date of report</b> | 12th August 2022  |



# Mortgage Valuation Report

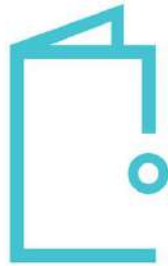

HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS  
Parent to HomeReportScotland.scot

## Property Address

Address 10 St Modans Place, Fraserburgh, AB43 9NT  
Seller's Name Mr I Graham  
Date of Inspection 15th July 2022

## Property Details

Property Type  House  Bungalow  Purpose built maisonette  Converted maisonette  
 Purpose built flat  Converted flat  Tenement flat  Flat over non-residential use  
 Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

## Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

## Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

Permanent outbuildings:

No permanent outbuildings.

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  Other (specify in General Remarks)  
Roof  Tile  Slate  Asphalt  Felt  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No

If Yes, is this recent or progressive?  Yes  No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No

If Yes to any of the above, provide details in General Remarks.

## Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage  Mains  Private  None Water  Mains  Private  None  
Electricity  Mains  Private  None Gas  Mains  Private  None  
Central Heating  Yes  Partial  None

Brief description of Central Heating:

Heating fuel: Gas  
Heating type: Radiators

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Ill-defined boundaries  Agricultural land included with property  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Mainly commercial  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

The subjects form part of an established Local Authority area lying to the southwest of Fraserburgh town centre. Surrounding properties are of a mixed residential and commercial nature. A wide range of facilities and amenities can be found within Fraserburgh.

The subjects were found to be in a condition of repair consistent with the age and type. Areas of routine maintenance, repair and upgrading are required.

The subjects form part of a block containing a flat and shop premises. It has been assumed that maintenance / repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors.

The ground floor of block is occupied by commercial use. A suitable source of mortgage finance should be obtained prior to committing to purchase.

The legal adviser should check confirm that the roads and sewers are adopted by the local authority.

It is assumed that there are no statutory, town planning, road or environmental matters which may have an adverse effect on the marketability or value of the property.

## Essential Repairs

None noted.

Estimated cost of essential repairs £  Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

The property affords adequate security for loan purposes based on the valuation figure, subject to individual lender's criteria.

## Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £   
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?  Yes  No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type?  Yes  No

## Declaration

Signed Security Print Code [462291 = 5309]O  
Electronically signed by:-

Surveyor's name Keith Alexander

Professional qualifications AssocRICS

Company name Harvey Donaldson And Gibson

Address Rubislaw Den House, 23 Rubislaw Den North, Aberdeen, AB15 4AL

Telephone 01224418749

Fax 0203 880 9193

Report date 12th August 2022



## PROPERTY QUESTIONNAIRE

|  |  |
|--|--|
| <b>Property Address</b>                          | 10, St modans place, Fraserburgh,<br>Ab439nt |
| <b>Vendor(s)</b>                                 | Mr Iain Graham                               |
| <b>Completion Date of Property Questionnaire</b> |  |
| <b>System Ref:</b>                               | QT709319-3                                   |

# HOME report

SINGLE SURVEY  
ENERGY REPORT  
PROPERTY QUESTIONNAIRE  
VALUATION REPORT





# PROPERTY QUESTIONNAIRE

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

|             |  |   |
|-------------|--|---|
| <b>1.</b>   | <b>Length of ownership</b>   |   |
|             | How long have you owned the property? 25 years approx  |   |
| <b>2.</b>   | <b>Council Tax</b>   |   |
|             | Which Council Tax band is your property in?  |   |
|             | A <input checked="" type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H <input type="checkbox"/>   |   |
| <b>3.</b>   | <b>Parking</b>   |   |
|             | What are the arrangements for parking at your property?<br><b>Please tick all that apply?</b>  |   |
|             | Garage <input type="checkbox"/> Allocated parking space <input type="checkbox"/> Driveway <input type="checkbox"/><br>Shared parking <input type="checkbox"/> On street <input checked="" type="checkbox"/> Resident permit <input type="checkbox"/><br>Metered parking <input type="checkbox"/> Other (please specify):   |   |
| <b>4.</b>   | <b>Conservation area</b>   |   |
|             | Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?   | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/><br>Don't know <input type="checkbox"/> |
| <b>5.</b>   | <b>Listed buildings</b>  |   |
|             | Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?   | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/>  |
| <b>6.</b>   | <b>Alterations/additions/extensions</b>  |   |
| <b>a.</b>   | During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/>  |
| <b>(i)</b>  | <b>If you have answered yes</b> , please describe below the changes which you have made:   |   |
| <b>(ii)</b> | Did you obtain planning permission, building warrant, completion certificate and other consents for this work?   | Yes <input type="checkbox"/><br>No <input type="checkbox"/>   |
| <b>(iv)</b> | <b>If you have answered yes</b> , the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: |   |



## PROPERTY QUESTIONNAIRE

|   |  |  |
|---|--|--|
| <b>6. Alterations/additions/extensions</b>            |  |  |
| <b>b.</b>   | Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>  |
| <b>(i)</b>  | Were the replacements the same shape and type as the ones you replaced?  | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>  |
| <b>(ii)</b>   | Did the work involve any changes to the window or door openings?   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>  |
| <b>(iii)</b>  | Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):<br><b>Upvc DG tt</b><br>Please give any guarantees which you received for this work to your solicitor or estate agent  |  |
| <b>7. Central heating</b>                             |  |  |
| <b>a.</b>   | Is there a central heating system in your property?<br>(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).<br><br><b>If you have answered yes or partial</b> – what kind of central heating is there?<br>(Examples: gas-fired, solid fuel, electric storage heating, gas warm air)<br><b>Gas wet</b><br><b>If you have answered yes.</b> please answer the three questions below | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/><br>Partial <input checked="" type="checkbox"/>                                       |
| <b>(i)</b>  | When was your central heating system or partial central heating installed?   | Over 25 years ago  |
| <b>(ii)</b>   | Do you have a maintenance contract for the central heating system?<br><br><b>If you answered yes</b> please give details of the company with whom you have a maintenance contract  | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>  |
| <b>(iii)</b>  | When was your maintenance contract last renewed? (Please provide the month and year)   |  |
| <b>8. Energy Performance Certificate</b>              |  |  |
|   | Does your property have an Energy Performance Certificate which is less than 10 years old?   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>  |
| <b>9. Issues that may have affected your property</b> |  |  |
| <b>a.</b>   | Has there been any storm, flood, fire, or other structural damage to your property while you have owned it?<br><br><b>If you have answered yes</b> is the damage the subject of any outstanding insurance claim?   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/><br>Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/> |
| <b>b.</b>   | Are you aware of the existence of asbestos in your property?<br><br><b>If you have answered yes</b> please give details:   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>  |







# PROPERTY QUESTIONNAIRE

| 10. Services   |  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|--|--|------------|-----------|----------|-----------------------------|-------------------------------------|------------|-------------------------------------|-------------------------------------|------------|-------------|-------------------------------------|------------|----------------|-------------------------------------|------------|-----------|-------------------------------------|----|-----------------------|--------------------------|--|-----------|--------------------------|--|
| Please tick which services are connected to your property and give details of the supplier |  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|  | <table border="1"> <thead> <tr> <th>Service</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td><input checked="" type="checkbox"/></td> <td>Don't know</td> </tr> <tr> <td>Water mains or private water supply</td> <td><input checked="" type="checkbox"/></td> <td>Don't know</td> </tr> <tr> <td>Electricity</td> <td><input checked="" type="checkbox"/></td> <td>Don't know</td> </tr> <tr> <td>Mains drainage</td> <td><input checked="" type="checkbox"/></td> <td>Don't know</td> </tr> <tr> <td>Telephone</td> <td><input checked="" type="checkbox"/></td> <td>Bt</td> </tr> <tr> <td>Cable TV or satellite</td> <td><input type="checkbox"/></td> <td></td> </tr> <tr> <td>Broadband</td> <td><input type="checkbox"/></td> <td></td> </tr> </tbody> </table> | Service    | Connected | Supplier | Gas or liquid petroleum gas | <input checked="" type="checkbox"/> | Don't know | Water mains or private water supply | <input checked="" type="checkbox"/> | Don't know | Electricity | <input checked="" type="checkbox"/> | Don't know | Mains drainage | <input checked="" type="checkbox"/> | Don't know | Telephone | <input checked="" type="checkbox"/> | Bt | Cable TV or satellite | <input type="checkbox"/> |  | Broadband | <input type="checkbox"/> |  |
| Service  | Connected  | Supplier   |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| Gas or liquid petroleum gas  | <input checked="" type="checkbox"/>  | Don't know |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| Water mains or private water supply  | <input checked="" type="checkbox"/>  | Don't know |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| Electricity  | <input checked="" type="checkbox"/>  | Don't know |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| Mains drainage   | <input checked="" type="checkbox"/>  | Don't know |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| Telephone  | <input checked="" type="checkbox"/>  | Bt         |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| Cable TV or satellite  | <input type="checkbox"/>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| Broadband  | <input type="checkbox"/>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| a.   |  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| b.   | <p>Is there a septic tank at your property?</p> <p><b>If you have answered yes</b> please answer the questions below</p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|  | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| (i)  | <p>Do you have appropriate consents for the discharge of your septic tank?</p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|  | <p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p>  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| (ii)   | <p>Do you have a maintenance contract for your septic tank?</p> <p><b>If you answered yes</b> please give details of the company with whom you have a maintenance contract</p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|  | <p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| 11. Responsibilities for shared or common areas  |  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| a.   | <p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as repair of a shared drive, private road, boundary, or garden area?</p> <p><b>If you answered yes</b> please give details</p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|  | <p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Don't know <input checked="" type="checkbox"/></p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| b.   | <p>Are you aware of any responsibility to contribute to the cost of repair and maintenance of the roof, common stairwell, or other common areas?</p> <p><b>If you answered yes</b> please give details</p> <p>Yes</p>  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|  | <p>Yes <input checked="" type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| c.   | <p>Has there been any major repair or replacement of any part of the roof during the time you have owned the building?</p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|  | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
| d.   | <p>Do you have the right to walk over any of your neighbours' property, for example to put out your bins, or to maintain your boundaries?</p> <p><b>If you answered yes</b> please give details</p> <p>Basic law</p>   |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |
|  | <p>Yes <input checked="" type="checkbox"/></p> <p>No <input type="checkbox"/></p>  |            |           |          |                             |                                     |            |                                     |                                     |            |             |                                     |            |                |                                     |            |           |                                     |    |                       |                          |  |           |                          |  |



## PROPERTY QUESTIONNAIRE

|            |   |   |
|------------|---|---|
| <b>11.</b> | <b>Responsibilities for shared or common areas</b>  |   |
| <b>e.</b>  | As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin, or to maintain their boundaries?<br><br><b>If you answered yes</b> please give details<br><br><b>Basic law</b>                | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>   |
| <b>f.</b>  | As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)<br><br><b>If you answered yes</b> please give details | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>   |
| <b>12.</b> | <b>Charges associated with your property</b>  |   |
| <b>a.</b>  | Is there a factor or property manager for your property?<br><br><b>If you answered yes</b> please provide name and address and give details relating to deposits held and charges   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>   |
| <b>b.</b>  | Is there a common buildings insurance policy?   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/><br>Don't know <input checked="" type="checkbox"/> |
|            | <b>If you answered yes</b> is the cost of insurance included in your monthly/annual factor's charges?   | Yes <input type="checkbox"/><br>No <input type="checkbox"/>   |
| <b>c.</b>  | Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.<br><b>None</b>   |   |
| <b>13.</b> | <b>Specialist works</b>   |   |
| <b>a.</b>  | As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?<br><br><b>If you answered yes</b> please give further details   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>   |
|            | Do you have any guarantees for this work?<br><br>Guarantees are held by :   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>   |
|            |   |   |
| <b>b.</b>  | As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?<br><br><b>If you answered yes</b> please give further details  | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>   |
|            | Do you have any guarantees for this work?<br><br>Guarantees are held by :   | Yes <input checked="" type="checkbox"/><br>No <input checked="" type="checkbox"/>   |
|            |   |   |



## PROPERTY QUESTIONNAIRE

| 14. Guarantees |   |   |                          |                          |                          |                          |
|----------------|---|---|--------------------------|--------------------------|--------------------------|--------------------------|
| a.             | Are there any warranties or guarantees for any of the following   | No  | Yes                      | Don't know               | With title deeds         | Lost                     |
|                |   | <input checked="" type="checkbox"/>   | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| (i)<br>b.      | Electrical work   | <input checked="" type="checkbox"/>   | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| (ii)<br>b.     | Roofing   | <input checked="" type="checkbox"/>   | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| (iii)<br>b.    | Central heating   | <input checked="" type="checkbox"/>   | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| (iv)<br>b.     | National House Building Council (NHBC)  | <input checked="" type="checkbox"/>   | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| (v)<br>b.      | Damp course   | <input checked="" type="checkbox"/>   | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| (vi)<br>b.     | Any other work or installation?<br>(for example cavity wall insulation, underpinning, indemnity policy) | <input checked="" type="checkbox"/>   | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| c.             | Are there any outstanding claims under any of the guarantees listed above?                              | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/>  |                          |                          |                          |                          |
|                | <u>If you answered yes</u> please give details  |   |                          |                          |                          |                          |
| 15. Boundaries |   |   |                          |                          |                          |                          |
| a.             | Are you aware has any boundary of your property been moved in the last ten years?                       | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/><br>Don't know <input type="checkbox"/> |                          |                          |                          |                          |
|                | <u>If you answered yes</u> please give details  |   |                          |                          |                          |                          |



## PROPERTY QUESTIONNAIRE

| 16. Notices that affect your property   |   |                              |  |
|---|---|------------------------------|--|
| In the past three years have you ever received a notice :   |   |                              |  |
| a.  | Advising that the owner of a neighbouring property has made a planning application?     | Yes <input type="checkbox"/> | No <input checked="" type="checkbox"/> |
| b.  | that affects your property in some other way?   | Yes <input type="checkbox"/> | No <input checked="" type="checkbox"/> |
| c.  | that requires you to perform any maintenance, repairs, or improvements to the property? | Yes <input type="checkbox"/> | No <input checked="" type="checkbox"/> |
| <b>If you answered yes to any of a-c above</b> please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property |   |                              |  |

**Declaration by the seller(s) or other authorised body or person(s)**

**I/We confirm that the information on this form is true and correct to the best of my/our knowledge and belief.**

**Signatures:**

**Iain A Graham**

**Date:**

**HOME**  
report

SINGLE SURVEY  
ENERGY REPORT  
PROPERTY QUESTIONNAIRE  
VALUATION REPORT





# Energy Performance Certificate (EPC)

# Scotland

Dwellings

10 ST MODANS PLACE, FRASERBURGH, AB43 9NT

**Dwelling type:** Top-floor flat  
**Date of assessment:** 15 July 2022  
**Date of certificate:** 20 July 2022  
**Total floor area:** 61 m<sup>2</sup>  
**Primary Energy Indicator:** 459 kWh/m<sup>2</sup>/year


**Reference number:** 9658-1013-5203-8772-1200  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

|  |               |  |
|--|---------------|--|
| <b>Estimated energy costs for your home for 3 years*</b> | <b>£3,090</b> | See your recommendations report for more information |
| <b>Over 3 years you could save*</b>                      | <b>£1,203</b> |  |

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

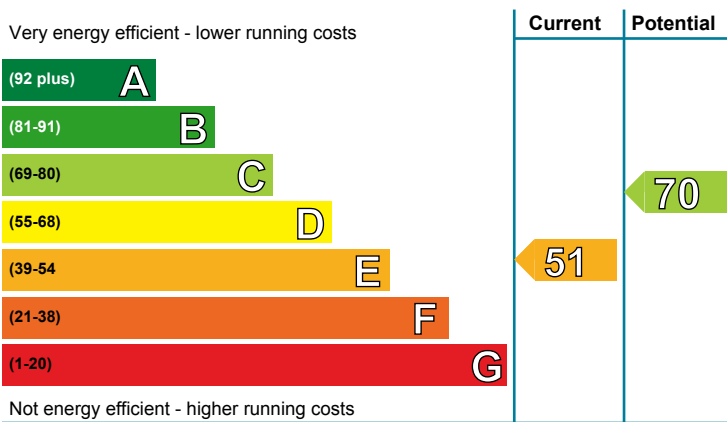


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (51)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

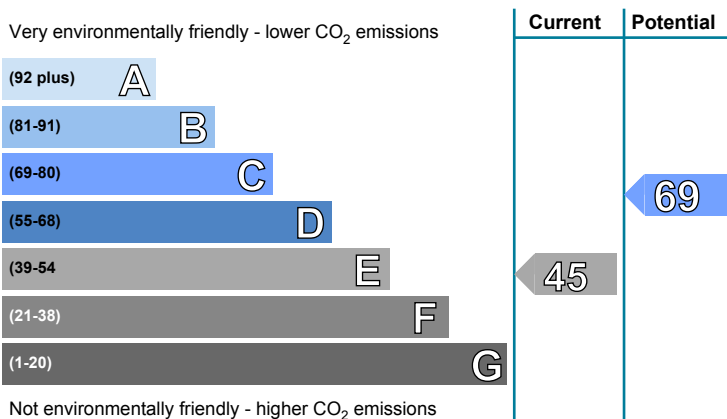

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (45)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

| Recommended measures                                | Indicative cost  | Typical savings over 3 years |
|---|------------------|------------------------------|
| 1 Increase loft insulation to 270 mm                | £100 - £350      | £198.00                      |
| 2 Internal or external wall insulation              | £4,000 - £14,000 | £474.00                      |
| 3 Add additional 80 mm jacket to hot water cylinder | £15 - £30        | £27.00                       |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element               | Description   | Energy Efficiency | Environmental |
|-----------------------|---|-------------------|---------------|
| Walls                 | Granite or whinstone, as built, no insulation (assumed) | ★★☆☆☆             | ★★☆☆☆         |
|                       | Timber frame, as built, partial insulation (assumed)    | ★★★★☆             | ★★★★☆         |
| Roof                  | Pitched, 75 mm loft insulation                          | ★★★★☆             | ★★★★☆         |
| Floor                 | (other premises below)                                  | —                 | —             |
| Windows               | Fully double glazed                                     | ★★★★☆             | ★★★★☆         |
| Main heating          | Boiler and radiators, mains gas                         | ★★★★☆             | ★★★★☆         |
| Main heating controls | Programmer, TRVs and bypass                             | ★★★★☆             | ★★★★☆         |
| Secondary heating     | Room heaters, dual fuel (mineral and wood)              | —                 | —             |
| Hot water             | From main system  | ★★★★☆             | ★★★★☆         |
| Lighting              | Low energy lighting in 83% of fixed outlets             | ★★★★★             | ★★★★★         |

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 83 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.








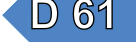


## Estimated energy costs for this home

|               | Current energy costs | Potential energy costs | Potential future savings  |
|---------------|----------------------|------------------------|---|
| Heating       | £2,391 over 3 years  | £1,413 over 3 years    |  |
| Hot water     | £507 over 3 years    | £282 over 3 years      |   |
| Lighting      | £192 over 3 years    | £192 over 3 years      |   |
| <b>Totals</b> | <b>£3,090</b>        | <b>£1,887</b>          |   |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.
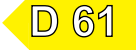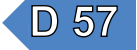
## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures                                | Indicative cost  | Typical saving per year | Rating after improvement  |   |
|---|------------------|-------------------------|---|---|
|   |                  |                         | Energy  | Environment   |
| 1 Increase loft insulation to 270 mm                | £100 - £350      | £66                     |  |  |
| 2 Internal or external wall insulation              | £4,000 - £14,000 | £158                    |  |  |
| 3 Add additional 80 mm jacket to hot water cylinder | £15 - £30        | £9                      |  |  |
| 4 Upgrade heating controls                          | £350 - £450      | £47                     |  |  |
| 5 Replace boiler with new condensing boiler         | £2,200 - £3,000  | £121                    |  |  |

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Micro CHP

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).



## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 3 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

### 4 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 5 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand                  | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 9,791             | (961)                     | N/A                              | (2,324)                         |
| Water heating (kWh per year) | 2,626             |                           |                                  |                                 |

## Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Keith Alexander  
Assessor membership number: EES/021472  
Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors  
Address: Rubislaw Den House  
23 Rubislaw Den North  
Aberdeen  
AB15 4AL  
Phone number: 01224 418749  
Email address: frances.wilson@hdg.co.uk  
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT





HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS  
Parent to HomeReportsScotland.acol

Rubislaw Den House, 23 Rubislaw Den North, Aberdeen AB15 4AL  
01224 418749 [aberdeen.residential@hdg.co.uk](mailto:aberdeen.residential@hdg.co.uk)